# SHUTTLE CRITICAL ITEMS LIST - ORBITER

UBSYSTEM : EFD&C - ET UMBIL DOORS FMEA NO 05-6ED-2252C -2 REV: 02/19/88

ASSEMBLY :AFT HCA 1,2,3 P/N RI :JANTXV1N4246

CRIT. FUNC: CRIT. HDW:

P/N VENDOR: QUANTITY

**VPHICLE** 102 103 104

: FOUR

EFFECTIVITY: X Х Х PHASE(S): PL TO X OO X DO

PREPARED BY:

( Carry 12-26 1)

7 Course Lot R. M. S.

REDUNDANCY SCREEN: A-PASS B-FAIL C-PASS

DES

APPROVED BY: QV Burn T BANHIDY DE5 . .

QΞ

APPROVED BY (NASA):

REL QĒ

H YEW REL W HIGGINS

REL

SSM\_ NOTONICE 344 QE Q ElDe son alling for we sky

ITEM:

EPOC REL 2/8/78 DIODE, BLOCKING LEFT/RIGHT DOOR CLOSE DRIVE CONTROL STIMULI CIRCUIT ISOLATION.

#### FUNCTION:

CONDUCTS REDUNDANT SIGNAL POWER TO THE HYBRID RELAY AND ISOLATES THE MANUAL SWITCH "CLOSE" LOGIC-SIGNAL FROM GPC "CLOSE" COMMAND LOGIC SIGNAL TO PREVENT INADVERTENT OPERATION OF THE RELAY. 54V76A114A2CR63, 55V76A115A1CR88 56V76A116A2CR8,52.

## FAILURE MODE:

FAILS SHORTED, CONDUCTS IN REVERSE DIRECTION.

#### USE(S):

MECHANICAL SHOCK, VIBRATION, THERMAL STRESS, ELECTRICAL STRESS, FROCESSING ANOMALY

### PFFECT(S) ON:

(A) SUBSYSTEM (B) INTERPACES (C) MISSION (D) CREW/VEHICLE (E) FUNCTIONAL CRITICALITY

(A,B) FIRST FAILURE - NO EFFECT. ISOLATION IS LOST BETWEEN RELAY STIMULI CIRCUITS FROM HOM'S AND MANUAL PANEL SWITCHES. UPON GPC COMMAND, SHORT OF DIODE CAUSES INADVERTENT ENERGIZING OF THE CLOSE RELAY WITHOUT THE ARM COMMAND. NO PREMATURE DOOR DRIVE OPERATION OCCURS SINCE EITHER C/L LATCHES OR CLOSE LATCHES MUST BE UNLATCHED BEFORE THE DOORS CAN BE MOVED. HOWEVER, CONTINUOUS MOTOR SPINNING WILL EVENTUALLY CAUSE DAMAGE TO THE MOTOR.

(C,D) FIRST FAILURE - NO EFFECT ON MISSION, CREW/VEHICLE.

### SHUTTLE CRITICAL ITEMS LIST - ORBITER

SUBSYSTEM : EPD&C - ET UMBIL DOORS FMEA NO 05-6ED-2252C -2 REV:02/19/88

(E) POSSIBLE LOSS OF CREW/VEHICLE THROUGH INADVERTENT ET DOOR OPERATION RESULTING IN STRUCTURAL DAMAGE CAUSED BY THERMAL EFFECTS DURING FLIGHT. REQUIRES THREE ADDITIONAL FAILURES (LOSS OF BOTH CENTERLINE LATCHES AND INADVERTENT GPC COMMANDS) BEFORE EFFECT IS HANIFESTED.

FAILS "B" SCREEN BECAUSE OF DIODE FAILED SHORT IS NOT DETECTABLE IN FLIGHT.

### DISPOSITION & RATIONALE:

- (A) DESIGN (B) TEST (C) INSPECTION (D) FAILURE HISTORY (E) OPERATIONAL USE
- (A-D) FOR DISPOSITION AND RATIONALE, REFER TO APPENDIX F, ITEM NO. 3 DIODE
- (B) GROUND TURNAROUND TEST
  VERIFY DIODE FUNCTION THROUGH ET DOOR SYSTEM CPC COMMAND INTEGRITY CHECK.
  GPC COMMANDS ARE SENT WITHOUT ARM COMMANDS AND PROPER MCA OP STATUS ARE
  VERIFIED. TESTS ARE PERFORMED FOR EVERY FLIGHT AND LRU REPLACEMENT.
- (E) OPERATIONAL USE NONE

4.00